

Service Information

VRZ SERVICE MANUAL REVISION

One of the part numbers in the 'VRZ' service manual (Publication No. EE14E-11163) has been corrected.

1. APPLICABLE PAGE

Page 41 ('5 GEAR REASSEMBLY' section)


2. REASON FOR REVISION

The Mitsubishi part number for the bolt 149917-1400 has been incorrectly inputted.

3. LOCATION OF CORRECTED PART NUMBER

- Location of corrected part number: Refer to 'Correction' in the figure below.
- Correct part number: **RBJP part number** 149917-1400 **Mitsubishi part number (corrected)** MH001566

5 GEAR REASSEMBLY

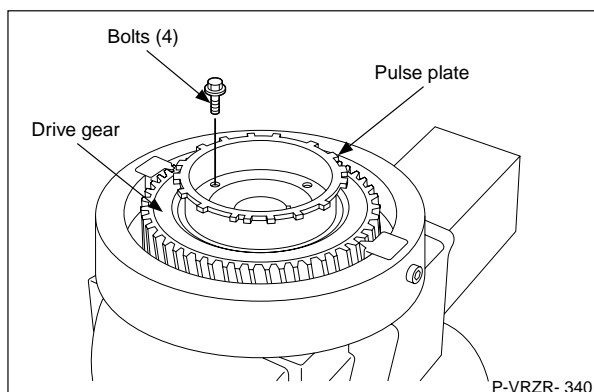

(15) Screw in the bolts (SW7) and tighten the pulse plate to the drive gear.

Specified torque: 4 ~ 5 N·m
{0.4 ~ 0.5 kgf·m}

Part name	Part no. (Mitsubishi part no.)	Remarks
Bolts	149917-1400 (MH001566)	4; not reusable

CAUTION

Bolts cannot be reused.

The above completes reassembly of the drive gear for the 4M41 model engine.

Correction